



GRANICRETE
INTERNATIONAL

Copper Antique

For this finish you will need:

1. Copper-Acid Free Stain
2. Cherokee-Dispersion
3. Stonehenge-Dispersion
4. Antique White – Acryli-Shade
5. Wickenburg White – Acryli-Shade
6. Blinding White – Acryli-Shade



Mixing Procedure:

1. Use Acid Free Stain at full strength in a *Granicrete* professional spray bottle.
2. Mix Cherokee (3 caps to 24oz of water) into a *Granicrete* professional spray bottle.
3. Mix Stonehenge (3 caps to 24oz of water) into a *Granicrete* professional spray bottle.
4. Mix Antique White (4oz to 20oz of water) into a *Granicrete* professional spray bottle.
5. Mix Wickenburg White (4oz to 20oz of water) into a *Granicrete* professional spray bottle.
6. Mix Blinding White (4oz to 20oz of water) into a *Granicrete* professional spray bottle.

Step-by-Step Procedure:

1. Apply all Granicrete Countertop Blend coats per installation instructions.
2. Mist and speckle 60% of the surface using Copper Acid Free stain. Allow to dry completely before proceeding.
3. Mist and speckle 50% of the surface using Cherokee. Allow to partially dry before proceeding.
4. Mist and speckle 50% of the surface using Stonehenge. Allow to partially dry before proceeding.
5. Mist and speckle 50% of the surface using Antique White. Allow to partially dry before proceeding.
6. Mist and speckle 50% of the surface using Wickenburg White. Allow to partially dry before proceeding.
7. Mist and speckle 50% of the surface using Blinding White.
8. Allow surface to completely dry and then apply Granicrete Crystal Top Epoxy per product instructions.

Professional Tip: Constantly shake up FX colors while being used in a spray bottle. The powder within each FX color is what makes them unique. If the color rest in the spray bottle the powder will settle to the bottom.

Copper Antique Notes:

